

645RT Series - Solid State Reversing 10 - 40 Amp



The 645RT series of solid state relays uses triacs for reversing phases on three phase loads. The most typical use is motor reversing. Inputs are DC operated. Load currents can range from 10 to 40 amps and up to a nominal voltage of 480VAC. Both random turn on or zero cross is available.



GENERAL SPECIFICATIONS (@ 25° C)


Input Characteristics	DC Input		
Input Voltage	4 - 32VDC		
Must Release Voltage	1VDC / 8VDC		
Maximum Input Current	80mA		
Reverse Polarity Protection	Yes		
Output Characteristics	10 Amp	25 Amp	40 Amp
Min. Load current to maintain on	100mA	120mA	250mA
Non-Repetitive Surge Current (1 cycle)	100A	250A	300A
Maximum I ² T for Fusing (Asquared sec)	50A ² S	312A ² S	450A ² S
Suggested Heatsink °C/W	0.5°C/W	0.14°C/W	0.14°C/W+FAN
Load Voltage Range	50 to 480VAC	50 to 480VAC	50 to 480VAC
Frequency Range	47 to 63 Hz	47 to 63 Hz	47 to 63 Hz
Peak Blocking Voltage	800 to 1200	800 to 1200	800 to 1200
Maximum Rate of Rise Off State Voltage (dv/dt)	250V/uS	250V/uS	250V/uS
Max. Off state leakage current (rms)	10mA	10mA	10mA
Max. On State Voltage Drop	1.6VAC	1.6VAC	1.6VAC
Maximum Turn-On Time @ 60 Hz	8.3mS	8.3mS	8.3mS
Maximum Turn-Off Time @ 60 Hz	8.3mS	8.3mS	8.3mS
Miscellaneous Characteristics			
Dielectric Strength - I or O to case	4000Vrms		
Operating Temperature Range	-30 to 80°C		
Storage Temperature Range	-40 to 100°C		
Weight	320g		
Input Terminal Size	M3.5		
Output Terminal Size	M4		

Motor Relays

15 - 75 Amp

The diagram shows a three-phase power supply (L1, L2, L3) at 440VAC. The lines pass through fuses F1 and F2. They then connect to a set of four contactors: R1, R2, 1, and 2. Contactors R1 and R2 are thermal relays, while 1 and 2 are contactors. The motor is connected to the output of these contactors. The diagram also shows a forward stop button (F) and a reverse stop button (R) connected to the control circuit.

Dimensions Shown in inches & (millimeters)

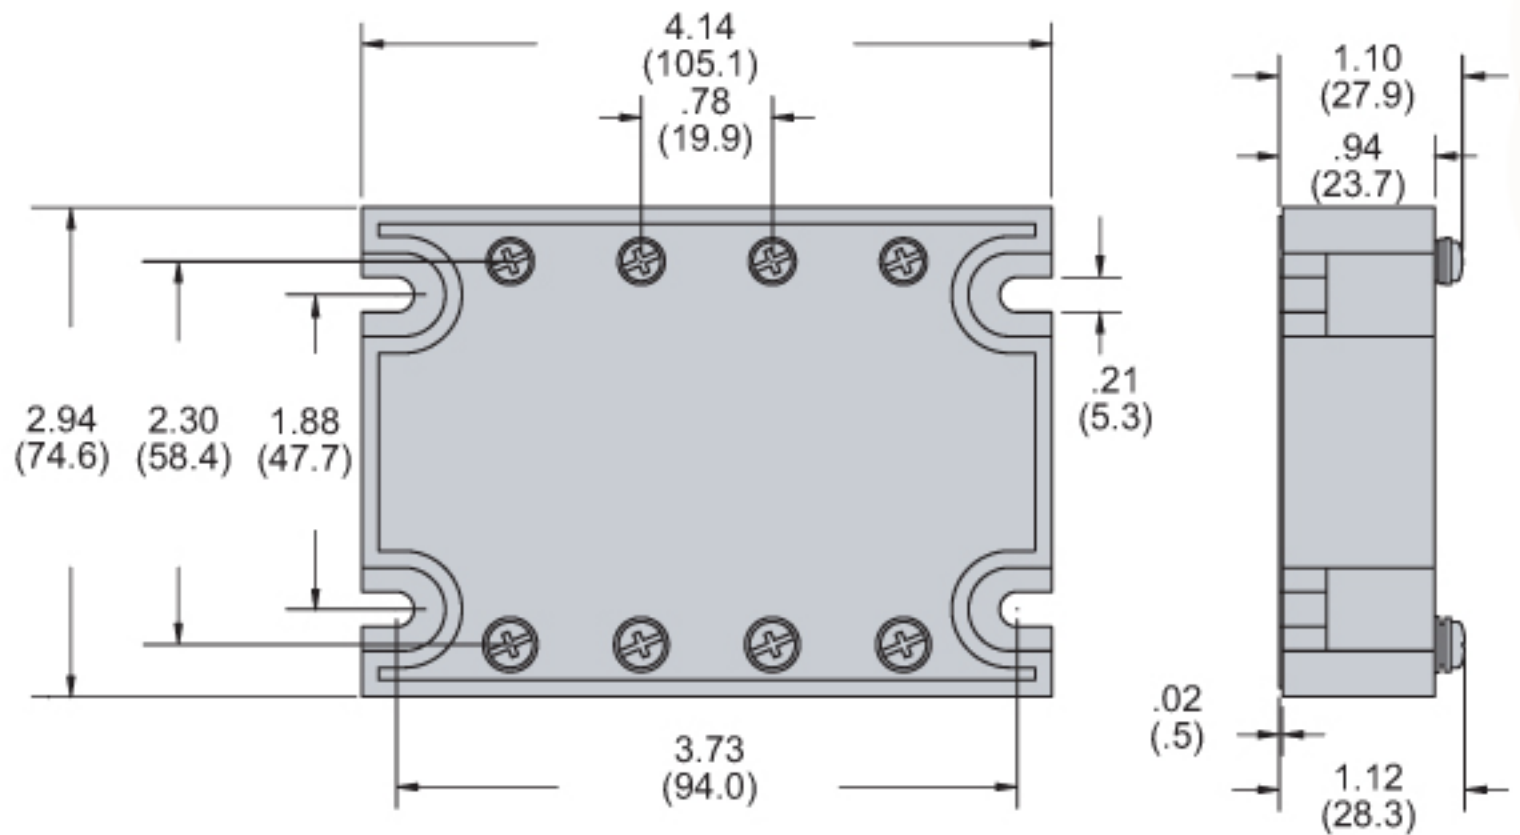

Input Voltage 4-32VDC

